

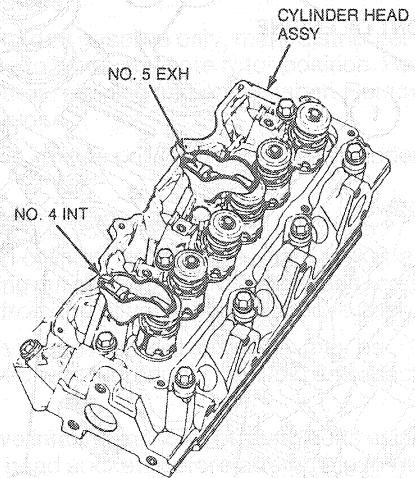
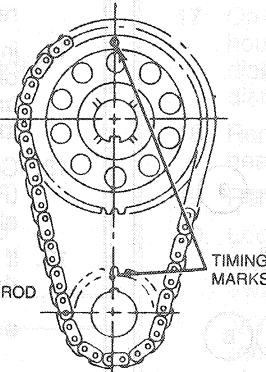
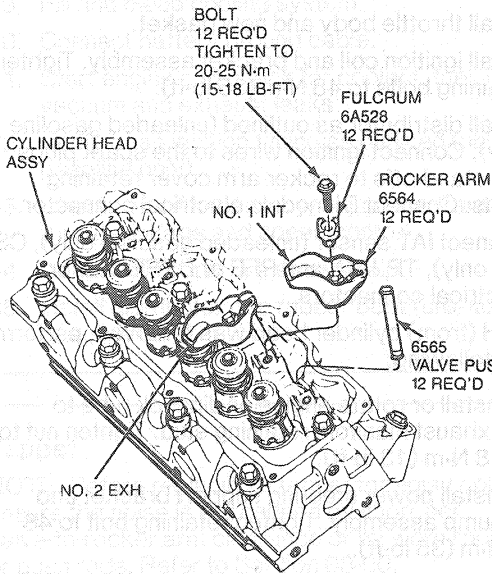
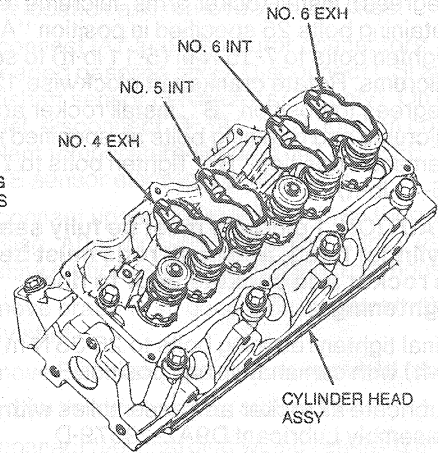
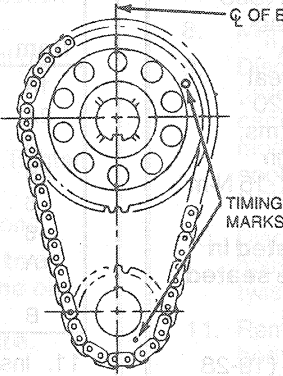


IN-VEHICLE SERVICE (Continued)

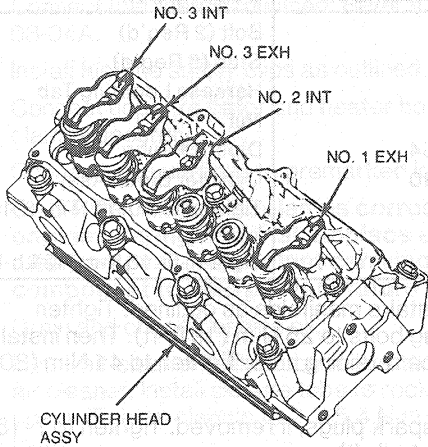

LEFT HEAD

FULCRUM AND BOLT MUST BE FULLY SEATED AFTER FINAL TORQUE

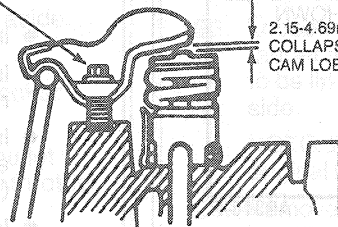

A13097-B